



the **play inspection** company
the safest hands around playgrounds

Post Installation Report

Creative Play (UK) Ltd.

The Steyning Centre Play Area

Fletchers Croft, Steyning, BN44 3XZ



API Associate

Unit 5, Glenmore Business Park, Blackhill Road, Poole, Dorset, BH16 6NL
t- 01202 590675 f- 0870 428 3942 e- info@playinspections.co.uk

www.playinspections.co.uk



Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity					
			Severity>>					
Likelihood	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
				1	2	3	4	5
				No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
				Severity>>				
Note 1: The total risk scores included within our reports are a multiplication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, ie. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).								
Note2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.								

Equipment has been assessed to the following standards where relevant:

BS EN 1176 Parts 1-11 (Playground equipment and surfacing)
 BS EN 14974 (Facilities for users of roller sports equipment)
 BS EN 15312 (Free access multi-sports equipment)
 BS EN 16899 (Parkour Equipment)
 BS EN 16630 (Outdoor Fitness Equipment).



Site Information

Inspection Ref: 766244

Site Ref: 57040

Customer Order: N/A

Inspected: 21-February-2019 - 09:25 by Chris Buss RPII Annual Inspector

Risk Assessment: L 9 Low Risk



Location:

The site is located in an area of public open space and is not directly overlooked by any properties in the local community.

Disabled Access:

Some accessible features; an area that presents difficulties to the majority of people with disabilities but in favourable circumstances and certainly in partnership can be accessed.



8 - Low Risk

Item: Site General
Manufacturer: Owner/Operator
Surface Type: N/A
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 2



Finding 1

It is recommended that information signs with emergency contact details are installed at each entrance/exit point to the playground - Provide in accordance with the recommendations set out in BS EN 1176

Finding 2

The landscaping is incomplete - Complete landscaping

3 - Very Low Risk

Item: Bench
Manufacturer: Not Identified
Surface Type: Gravel
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



 3 - Very Low Risk

Item: Picnic Table
Manufacturer: Not Identified
Surface Type: Wet Pour
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -

 3 - Very Low Risk

Item: Play Panel
Manufacturer: Creative Play
Surface Type: Wet Pour
Equipment Compliance: Yes
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



 4 - Very Low Risk

Item: Spring Dog
Manufacturer: Creative Play
Surface Type: Wet Pour
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 1



Finding 1

There is no identification label affixed to the equipment - Provide an identification label

 4 - Very Low Risk

Item: Spring Duck
Manufacturer: Creative Play
Surface Type: Wet Pour
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 1



Finding 1

There is no identification label affixed to the equipment - Provide an identification label



4 - Very Low Risk

Item: See Saw
Manufacturer: Creative Play
Surface Type: Wet Pour
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 1



Finding 1

There is no identification label affixed to the equipment - Provide an identification label

8 - Low Risk

Item: Tractor
Manufacturer: Creative Play
Surface Type: Wet Pour
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 3



Finding 1

There is significant flexibility within the panel above the 'front' window, gaps in excess of 12mm can be opened up - Secure panel

Finding 3

There is no identification label affixed to the equipment - Provide an identification label

Finding 2

There are a number of missing fixings in and around the tunnel - Provide all missing fixings



4 - Very Low Risk

Item: 1 Bay 2 Seat (Cradle)
Manufacturer: Creative Play
Surface Type: Wet Pour
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 1



Finding 1

There is no identification label affixed to the equipment - Provide an identification label

8 - Low Risk

Item: Roundabout
Manufacturer: Not Identified
Surface Type: Wet Pour
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 2



Finding 1

The distance between the underside of the roundabout platform and the playing surface is in excess of 110mm and contravenes the requirements of BS EN 1176 Part 5 which requires that the distance be maintained between 60mm-110mm - for the entire circumference of the roundabout (upto 125mm around approximately 50% of the circumference) - Refer to the contractor

Finding 2

There is no identification label affixed to the equipment - Provide an identification label



4 - Very Low Risk

Item: 1 Bay 2 Seat (Flat)
Manufacturer: Creative Play
Surface Type: Wet Pour
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 1



Finding 1

There is no identification label affixed to the equipment - Provide an identification label

9 - Low Risk

Item: Multi Play (Junior)
Manufacturer: Creative Play
Surface Type: Wet Pour
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 6



Finding 1

The slide side height is 40mm less than the 150mm recommended by BS EN 1176 for this slide (free height of fall exceeds 1.2m) - Refer to the manufacturer

Finding 3

There are unused fixing points under the top of the tunnel slide - Refer to the manufacturer and provide if required

Finding 5

There are finger entrapments in some platform corners and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers - Refer to the manufacturer

Finding 2

The connecting links are in excess of 8.6mm and less than 12mm and fail the requirements of BS EN 1176 Part 1; clause 4.2.13, Chains - Refer to manufacturer

Finding 4

There are bolt cap covers missing on the tunnel slide - Provide missing bolt cap covers

Finding 6

There are gaps between the sliding sections inside the tunnel slide - Remove gaps



Findings information

2 - Very Low Risk (Finding 1)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: V - Very Low Risk
Surface: N/A



Finding: It is recommended that information signs with emergency contact details are installed at each entrance/exit point to the playground
Action: Provide in accordance with the recommendations set out in BS EN 1176

8 - Low Risk (Finding 2)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: The landscaping is incomplete

Action: Complete landscaping



i 4 - Very Low Risk (Finding 1)

Item: Rocking Equipment - Spring Dog
Manufacturer: Creative Play

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: There is no identification label affixed to the equipment

Action: Provide an identification label

i 4 - Very Low Risk (Finding 1)

Item: Rocking Equipment - Spring Duck
Manufacturer: Creative Play

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: There is no identification label affixed to the equipment


Action: Provide an identification label



 4 - Very Low Risk (Finding 1)

Item: Rocking Equipment - See Saw
Manufacturer: Creative Play

Risk Level: V - Very Low Risk
Surface: Wet Pour

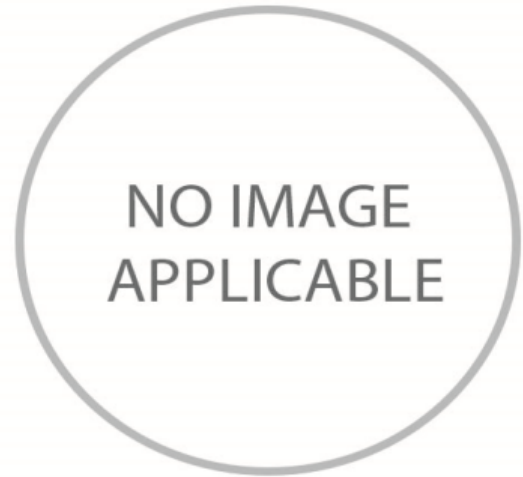

Finding: There is no identification label affixed to the equipment

Action: Provide an identification label



i 6 - Low Risk (Finding 1)

Item: Activity Equipment - Tractor
Manufacturer: Creative Play

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There is significant flexibility within the panel above the 'front' window, gaps in excess of 12mm can be opened up
Action: Secure panel



i 8 - Low Risk (Finding 2)

Item: Activity Equipment - Tractor
Manufacturer: Creative Play

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There are a number of missing fixings in and around the tunnel

Action: Provide all missing fixings



i 0 - Risk Assessment not Undertaken (Finding 3)

Item: Activity Equipment - Tractor
Manufacturer: Creative Play

Risk Level: N - Risk Assessment not Undertaken
Surface: Wet Pour



Finding: There is no identification label affixed to the equipment

Action: Provide an identification label



i 4 - Very Low Risk (Finding 1)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Creative Play

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: There is no identification label affixed to the equipment

Action: Provide an identification label





 8 - Low Risk (Finding 1)

Item: Rotor Play - Roundabout
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The distance between the underside of the roundabout platform and the playing surface is in excess of 110mm and contravenes the requirements of BS EN 1176 Part 5 which requires that the distance be maintained between 60mm-110mm - for the entire circumference of the roundabout (upto 125mm around approximately 50% of the circumference)

Action: Refer to the contractor

 0 - Risk Assessment not Undertaken (Finding 2)

Item: Rotor Play - Roundabout
Manufacturer: Not Identified

Risk Level: N - Risk Assessment not Undertaken
Surface: Wet Pour



Finding: There is no identification label affixed to the equipment

Action: Provide an identification label



i 4 - Very Low Risk (Finding 1)

Item: Swings - 1 Bay 2 Seat (Flat)
Manufacturer: Creative Play

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: There is no identification label affixed to the equipment

Action: Provide an identification label

i 8 - Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Creative Play

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The slide side height is 40mm less than the 150mm recommended by BS EN 1176 for this slide (free height of fall exceeds 1.2m)

Action: Refer to the manufacturer



i 5 - Very Low Risk (Finding 2)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Creative Play

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: The connecting links are in excess of 8.6mm and less than 12mm and fail the requirements of BS EN 1176 Part 1; clause 4.2.13, Chains

Action: Refer to manufacturer

i 4 - Very Low Risk (Finding 3)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Creative Play

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: There are unused fixing points under the top of the tunnel slide

Action: Refer to the manufacturer and provide if required



i 4 - Very Low Risk (Finding 4)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Creative Play

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: There are bolt cap covers missing on the tunnel slide

Action: Provide missing bolt cap covers



i 5 - Very Low Risk (Finding 5)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Creative Play

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: There are finger entrapments in some platform corners and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers

Action: Refer to the manufacturer



 9 - Low Risk (Finding 6)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Creative Play

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There are gaps between the sliding sections inside the tunnel slide
Action: Remove gaps